INSPECTION REPORT



For the Property at:

SAMPLE REPORT

Inspection Date: Tuesday, December 21, 2021 Prepared by: Travis Halldorson



Wizard Home Inspections 9711 Cedar Pl Summerland, BC V0H1Z2 250-274-2047

www.wizardhomeservices.ca travis@wizardhomeservices.ca

Excellence in home inspection.

SUMMARY

	www.w	izardhome	eservices.ca
--	-------	-----------	--------------

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								

This Summary outlines potentially significant issues from a cost or safety standpoint. This section is provided as a courtesy and cannot be considered a substitute for reading the entire report. Please read the complete document. <u>Priority Maintenance Items</u>

Exterior

WALLS \ Stucco

Condition: • Cracks & Damage

Stucco is damaged in various locations and should be repaired to prevent water infiltration.

Implication(s): Chance of water damage to structure, finishes and contents | Material deterioration | Possible hidden damage

Location: Exterior Wall Task: Repair/Seal all openings and cracks Time: Upon possession

LANDSCAPING \ Lot grading

Condition: • Improper slope or drainage

The lot grade slopes towards the house, creating a potential for leakage below grade. Re-grading where needed is recommended to ensure that all water drains away from the homes' foundation at all times. **Implication(s)**: Chance of water damage to structure, finishes and contents **Location**: Throughout exterior **Task**: Re-grade areas that slope toward house **Time**: Upon possession

Structure

FOUNDATIONS \ General notes

Condition: • Settled

Evidence that the house has settled. Ask seller settlement history and if this is new or old. Ask seller if this issue has been investigated by professional to determine cause and request report. If cracks and settlement are new or no investigation has been conducted, have area further evaluated by engineer to determine cause and provide a recommendation. The slab sounds hollow in areas which indicates possible water undermining.

Implication(s): Chance of further structural movement

Location: Basement utility area

Task: Further evaluation / Request disclosure

Time: Before subject removal

Condition: • Cracked horizontally

Horizontal cracks larger that 1/8th of an inch found in foundation wall. These cracks should be sealed by processional. Further investigation by foundation specialist is recommended to assure future structural movement is not an issue. Implication(s): Chance of structural movement Location: Front basement Task: Further evaluation

Time: Before subject removal

SUMMARY

3458 Parkview Court, West Kelowna, BC December 21, 2021

December 21, 2021 www.wizardhomeservices.ca

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								

Condition: • <u>Mechanical damage</u>

Concrete around water main has been damaged. This area has an active water leak and requires repair. **Implication(s)**: Chance of water entering building I Weakened structure I Chance of structural movement **Location**: Basement Utility Room **Task**: Repair & Further evaluation **Time**: Before subject removal

Electrical

DISTRIBUTION SYSTEM \ Carbon monoxide (CO) alarms (detectors)

Condition: • None observed Recommend installing CO detectors upon possession in appropriate areas. Periodic testing is suggested to ensure proper working order. Implication(s): Health hazard Location: Each floor level Task: Provide Time: Upon possession

Heating

GAS FURNACE \ Life expectancy

Condition: • Past life expectancy

Old furnace, have heating specialist estimate remaining life and replacement costs, anticipate replacement. 35 year-old furnace, typically these furnaces last 18 to 25 years. If furnace fails, there will be no heat. Potential health issue if furnace not serviced.

Implication(s): Equipment failure I No heat for building I Possible hazardous combustion products entering home Location: Basement Furnace Room

Task: Further Evaluation

Time: Before subject removal

Plumbing

SUPPLY PLUMBING \ Water service pipe

Condition: • Leak Slow water leak noted at main water shutoff valve. Implication(s): Chance of water damage to structure, finishes and contents I Damage to equipment Location: Basement Utility Room Task: Review and repair by Plumber Time: Before subject removal

www.wizardhomeservices.ca

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								

Interior

GARAGE \ Door between garage and living space

Condition: • <u>No self closer</u> Garage doors should always have self closing hinges. Implication(s): Hazardous combustion products entering home Location: Garage Task: Improve Time: Upon possession or before parking vehicle inside.

This concludes the Summary section.

The remainder of the report describes each of the home's systems and also details any recommendations we have for improvements. Limitations that restricted our inspection are included as well.

The suggested time frames for completing recommendations are based on the limited information available during a pre-purchase home inspection. These may have to be adjusted based on the findings of specialists.

Home Improvement - ballpark costs

ROOFING

Report No. 1014



Roof photos



1. Roof photos

• Roofs can leak unpredictably. Inspector cannot and does not guarantee as to if the roof has leaked in the past, leaks now, or may leak in the future. Visual inspection is based on a limited visual review of the roofing material. All roofs should be kept clean and be inspected annually.

The home is considered to face: • South Sloped roofing material: • Asphalt shingles Sloped roof flashing material: • Metal Approximate age: • Not Determined Typical life expectancy: • 20-25 years Roof Shape: • Gable

Limitations

General: • Have roof inspected after snow melts

Roof inspection limited/prevented by:

Snow/ice/frost

www.wizardhomeservices.ca

ROOFING

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								



2. Snow/ice/frost

Inspection performed: • With binoculars • From roof edge

Recommendations

RECOMMENDATIONS \ General

1. Condition: • Have Roof Inspected

Roof was covered by snow during inspection. Ask seller details on approximate age of roof and its history. There was no evidence inside attic or house of any leak history.

Location: Roof

Task: Further evaluation / Request disclosure

Time: After snow fall

2. Condition: • There are heat wires installed to possibly help prevent Ice damming in gutters. Ask seller history and purpose for heat wires and there effectiveness. Gutters were filled with ice during inspection.

Implication(s): Ice damming can create water ingress that may damage contents, materials and structure.

Location: Roof

Task: Request disclosure

Time: Before subject removal

www.wizardhomeservices.ca

ROOFING

3458 Parkview Court, West Kelowna, BC December 21, 2021

0100		now obuit, i	100111010101	IQ, DO DO		/_ 1				
SUMM	IARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE I	NFO	APPENDIX								

3. Heat wires and leaf guards

3. Condition: • Gutter guards are installed on gutters. These help keep debris from getting into gutters. An annual cleaning and gutter check is still advised.

Implication(s): Water leaks may damage contents, materials and structure and create mold.

Location: Roof

Task: Service

Time: Regular annual maintenance & ongoing

www.wizardhomeservices.ca

ROOFING

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								



4. Gutter guards

SLOPED ROOFING \ Asphalt shingles

4. Condition: • Damage

Small damaged corner observed. Inspect roof for other similar damaged areas when roof is clear from snow. **Implication(s)**: Chance of water damage to structure, finishes and contents **Location**: Roof

Task: Further evaluation

Time: After snow melt



5. Damage

ROOFING

Report No. 1014

www.wizardhomeservices.ca

3458 Parkview Court, West Kelowna, BC December 21, 2021

ion ooun, i		ia, DO DOC		021			
ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING

O APPENDIX

SLOPED ROOF FLASHINGS \ Pipe/stack flashings

5. Condition: • Damage

Neoprene flashing has collapsed possibly allowing for water ingress.

Implication(s): Chance of water damage to structure, finishes and contents

Location: Exterior roof

Task: Replace

Time: Before next winter season



6. Collapsed boot

EXTERIOR

Report No. 1014



General:

House angles



7. Front



8. Right





9. Rear

Gutter & downspout material: • <u>Aluminum</u> Gutter & downspout type: • <u>Eave mounted</u> Gutter & downspout discharge: • <u>Above grade</u>

10. Left

ΓERIOR

3458 Parkview Court West Kelowna BC December 21 2021

3458 Parkview Court, West Kelowna, BC December 21, 2021	www.wizardhomeservices.ca								
SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLIN	G INSULATION PLUMBING INTERIOR								
SITE INFO APPENDIX									
Downspout discharge: • Above grade									
Lot slope: • Towards building									
Soffit (underside of eaves) and fascia (front edge of eaves): • Metal									
Wall surfaces and trim: • Stucco • Fiber cement									
Retaining wall: • Masonry									
Driveway: • Interlocking brick									
Walkway: • Interlocking brick									
Garage: • Attached									
Garage vehicle door operator (opener): • Present									

Limitations

Inspection limited/prevented by: • Snow / ice / frost

Exterior inspected from: • Ground level

Not included as part of a building inspection: • Underground components (e.g., oil tanks, septic fields, underground drainage systems) • Screens, shutters, awnings, and similar seasonal accessories • Fences and boundary walls • Geological and soil conditions • Outbuildings other than garages and carports • Erosion control, earth stabilization measures

Recommendations

RECOMMENDATIONS \ General

6. Condition: • Hot tub is too close to house.

Implication(s): Water leaks may damage contents, materials and structure and create mold.

Location: Rear Exterior

Task: Move hot tub at least 6 feet away from house

Time: Upon possession

www.wizardhomeservices.ca

EXTERIOR

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								



11. Too close to siding

ROOF DRAINAGE \ Gutters

7. Condition: • Loose or damaged
Gutter down spout not attached to house.
Implication(s): Chance of water damage to structure, finishes and contents
Location: Right Side Exterior
Task: Repair
Time: Upon possession

3458 Park	view Court, \	,	www.wizardhom	eservices.ca					
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								
			5,20						
				自我	The Martin Martin	A CAL			
						The			
			a market for the second			12 流行			
					2 and				

12. Loose gutters down spout

ROOF DRAINAGE \ Downspouts

8. Condition: • Should discharge 6 feet from building

Make sure all downspouts discharge water 6 feet away from building and lot grade slopes away from house. Implication(s): Chance of water damage to structure, finishes and contents | Water can undermine the foundation causing settlement


Location: Throughout

Task: Recommend installation of extension to ensure proper drainage away from foundation

Time: Upon possession

EXTERIOR

3458 Parkview Court, West Kelowna, BC December 21, 2021 Report No. 1014

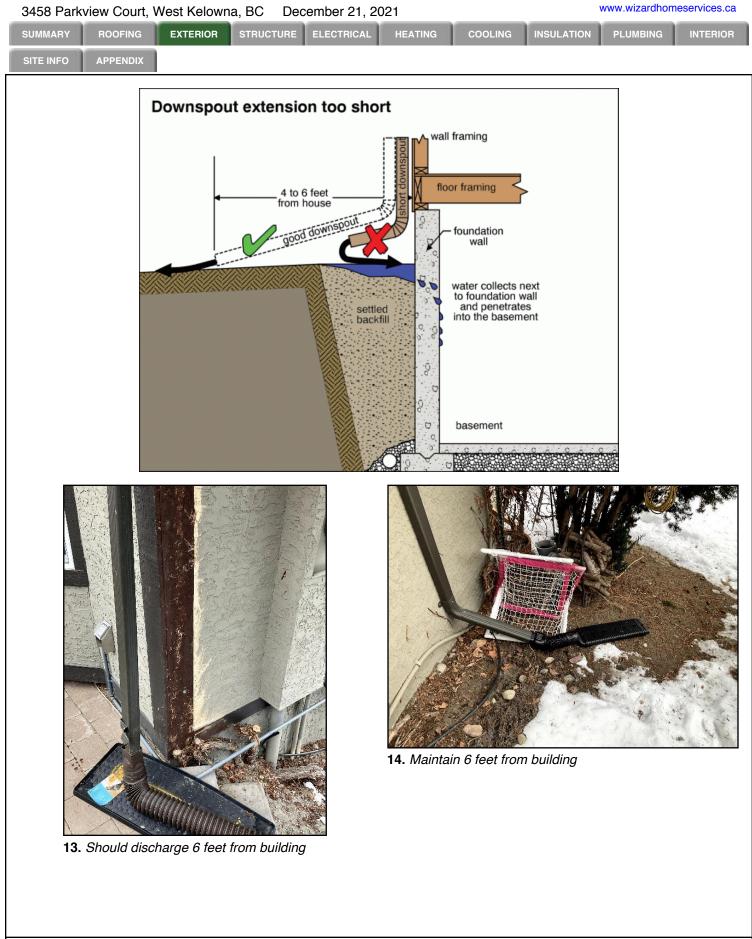

Report No. 1014 3458 Parkview Court, West Kelowna, BC December 21, 2021 SUMMARY ROOFING STE INFO APPENDIX



15. Should discharge 6 feet from building



16. Maintain 6 feet from building

WALLS \ Soffits (underside of eaves) and fascia (front edge of eaves)

9. Condition: • <u>Damage</u>
Fascia has unsealed nail penetrations from Christmas light anchors.
Implication(s): Chance of water damage to structure, finishes and contents
Location: Left Side Exterior

Task: Seal holes - Repair or replace fascia

Time: Prior to next winter season



17. Damage

www.wizardhomeservices.ca

EXTERIOR

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								

WALLS \ Stucco

10. Condition: • Cracks & Damage

Stucco is damaged in various locations and should be repaired to prevent water infiltration.

Implication(s): Chance of water damage to structure, finishes and contents I Material deterioration I Possible hidden damage

Location: Exterior Wall

Task: Repair/Seal all openings and cracks

Time: Upon possession



18. Cracked



19. Cracked

<text><text><text><text><text>

20. Cracked

11. Condition: • Too close to grade

Stucco siding on left side has planters that are built against siding in some areas.

Implication(s): Chance of water damage to structure, finishes and contents | Material deterioration | Potential hidden damage

21. Mechanical damage


Location: Left Side Exterior Wall

Task: Have planters removed or dug down to below stucco siding Time: Upon possession

EXTERIOR

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								

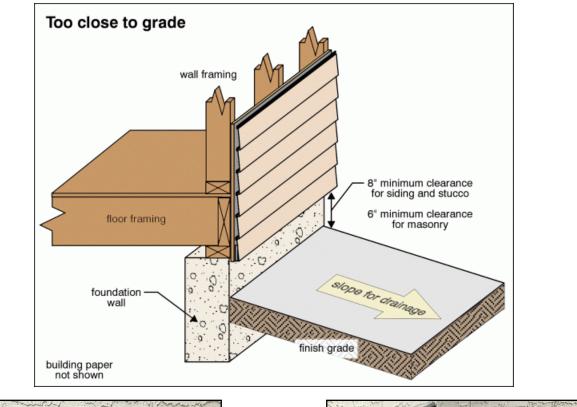



22. Too close to grade



23. Too close to grade

www.wizardhomeservices.ca

EXTERIOR 3458 Parkview Court, West Kelowna, BC

BC December 21, 2021

SUMMARY ROOFIN	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO APPEND	x							



24. Too close to grade

12. Condition: • Stucco Maintenance


Stucco wall cladding requires annual review and maintenance. All door/window/trim junctions should be kept sealed and inspected to prevent water ingress behind the Stucco wall. Should you see any damage or cracks larger than 1/16", recommend sealing/repairing these to prevent water ingress.

Implication(s): Chance of water damage to structure, finishes and contents | Material deterioration

Location: Throughout Exterior Wall

Task: Monitor and Maintain

Time: Regular maintenance & ongoing

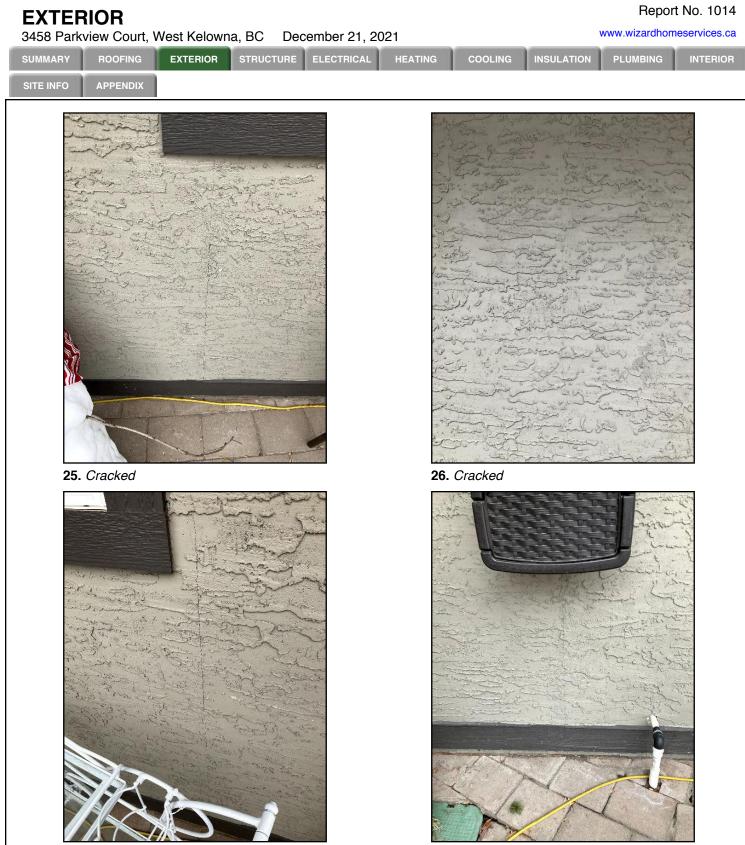

28. Cracked

WALLS \ Vent (fan, clothes dryer, etc.)

13. Condition: • Cover damaged

27. Cracked

Dryer vent and basement bathroom exhaust vent are damaged and need repair.

Providing great home inspections for every client every time

Report No. 1014 Steps: Steps: Steps: Steps: Step: Step:

Location: Rear exterior

Task: Repair

Time: Upon possession



29. Cover damaged

14. Condition: • Abandoned

Old vent pipes uncovered need to be sealed. Implication(s): Heat / AC loss I Vermin entry Location: Rear Task: Seal and cover openings Time: Upon possession



30. Cover damaged

www.wizardhomeservices.ca

EXTERIOR

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								
			and the second						

18-57

31. Abandoned vents

WINDOWS \ General notes

15. Condition: • Paint and Caulking - deteriorated / missing
Garage windows need to be sealed around perimeter.
Implication(s): Increased heating and cooling costs I Reduced comfort
Location: Left Side Exterior
Task: Improve
Time: Prior to next winter season

EXTER 3458 Park	RIOR view Court, V	West Kelowr	na, BC Dec	cember 21, 20)21			Repor www.wizardhon	t No. 1014 neservices.ca
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX	1							



33. Caulking required

32. Caulking required

EXTERIOR GLASS/WINDOWS \ Exterior trim

16. Condition: • Paint or stain needed

OSB trim boards require paint to prevent swelling.

Implication(s): Chance of water damage to structure, finishes and contents | Material deterioration

Location: Left & Right Side Exterior Wall Task: Protect

Time: Upon possession

Report No. 1014 3458 Parkview Court, West Kelowna, BC December 21, 2021 www.wizardhomeservices.ca SUMMARY ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR SITE INFO APPENDIX Image: Construct of the structure of



34. MePaint or stain neededchanical damage

DOORS \ General notes

17. Condition: • No deadbolt lock
The garage door does not have a deadbolt lock installed.
Implication(s): Security issue
Location: Garage
Task: Provide and install
Time: Discretionary



35. Paint or stain needed

www.wizardhomeservices.ca

EXTERIOR

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								



36. No deadbolt lock

LANDSCAPING \ General notes

18. Condition: • Trees or shrubs too close to building

Recommend keeping vegetation and dirt/mulch away from wall cladding.

Implication(s): Chance of water damage to structure, finishes and contents | Chance of pests entering building | Material deterioration

Location: Right exterior wall

Task: Remove vegetation

Time: Upon possession

Report No. 1014 EXTERIOR www.wizardhomeservices.ca 3458 Parkview Court, West Kelowna, BC December 21, 2021 ROOFING EXTERIOR SITE INFO APPENDIX 8 Trees and shrubs too close to house B 4 P. roof abrasion damage clogged iding and reduce drying potential falling branches roots may clog pipes-and move foundation or footings 37. Trees or shrubs too close to building

LANDSCAPING \ Lot grading

19. Condition: • Improper slope or drainage

Providing great home inspections for every client every time

EXTERIOR



EXTERIOR



EXTERIOR 3458 Parkview Court, West Kelowna, BC December 21, 2021

www.wizardhomeservices.ca

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOF



40. Improper slope or drainage



41. Improper slope or drainage



42. Improper slope or drainage

LANDSCAPING \ Walkway

20. Condition: • Uneven (trip hazard)
Access to right side of house is unfinished and has trip hazards.
Implication(s): Physical injury
Location: Right side walkway
Task: Finish / Repair
Time: Upon possession

EXTEF	RIOR							Repor	t No. 1014
3458 Park	view Court, V	West Kelowr	na, BC Dec	ember 21, 20	021			www.wizardhom	eservices.ca
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX	1							
						N/			
			The set		CONTROL	and the second			

43. Uneven (trip hazard)

IRRIGATION/SPRINKLER SYSTEM \ Observations

21. Condition: • Poor service location for irrigation system. They are both situated near foundation wall at a low spots and if a leak were to ever occur a water could find its way into the home.

Implication(s): Water leaks may damage contents, materials and structure and create mould.

Location: Front Rear

Task: Water leak alarm is suggested to prevent serious water damage

Time: Upon possession

EXTERIOR

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								



44. Irrigation



45. Irrigation

Providing great home inspections for every client every time

www.wizardhomeservices.ca

STRUCTURE

www.wizardhomeservices.ca 3458 Parkview Court, West Kelowna, BC December 21, 2021 ROOFING STRUCTURE COOLING INSULATION PLUMBING SITE INFO APPENDIX Description Configuration: Basement Foundation material: • Poured concrete Floor construction: • Joists Exterior wall construction: • Not visible Roof and ceiling framing: • Trusses Limitations

Inspection limited/prevented by: • New finishes/paint

Attic/roof space:
 Inspected from access hatch

Not included as part of a building inspection: • Visible mold evaluation is not included in the building inspection report • An opinion about the adequacy of structural components • Attic load bearing components concealed by insulation cannot be traversed

Recommendations

FOUNDATIONS \ General notes

22. Condition: • Settled

Evidence that the house has settled. Ask seller settlement history and if this is new or old. Ask seller if this issue has been investigated by professional to determine cause and request report. If cracks and settlement are new or no investigation has been conducted, have area further evaluated by engineer to determine cause and provide a recommendation. The slab sounds hollow in areas which indicates possible water undermining. Implication(s): Chance of further structural movement Location: Basement utility area Task: Further evaluation / Request disclosure Time: Before subject removal

STRUCTURE

3458 Parkview Court, West Kelowna, BC December 21, 2021

1				-	,				
	SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING
	SITE INFO	APPENDIX							



46. Settled



48. Settled



47. Settled




49. Doors altered

23. Condition: • Cracked horizontally

Horizontal cracks larger that 1/8th of an inch found in foundation wall. These cracks should be sealed by processional. Further investigation by foundation specialist is recommended to assure future structural movement is not an issue.

www.wizardhomeservices.ca

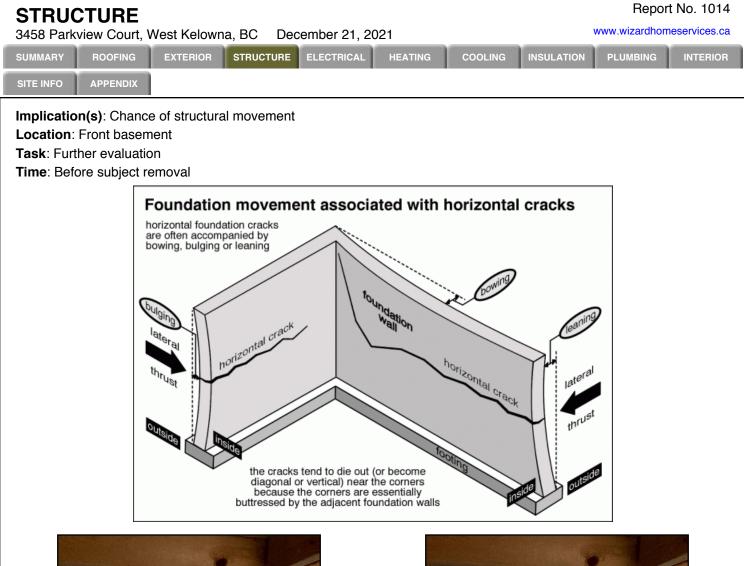



50. Cracked horizontally



51. Cracked horizontally

_	OCTURE Parkview Court,	West Kelowr	na, BC Dec	cember 21, 2	021			Report No. 1014 www.wizardhomeservices.ca	
SUMMA	RY ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INF	O APPENDIX								
			6			trade and the second	10		




52. Cracked horizontally

24. Condition: • Mechanical damage

Concrete around water main has been damaged. This area has an active water leak and requires repair. Implication(s): Chance of water entering building I Weakened structure I Chance of structural movement Location: Basement Utility Room

Task: Repair & Further evaluation

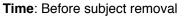



53. Mechanical damage

www.wizardhomeservices.ca

ELECTRICAL 3458 Parkview Court, West Kelowna, BC December 21, 2021 COOLING ELECTRICAL

ROOFING

SITE INFO APPENDIX

Description

General:

• Electrical Meter



• Electric Panel

54. Electrical Meter



55. Electric Panel

Providing great home inspections for every client every time

ELECTRICAL

Report No. 1014

www.wizardhomeservices.ca

3458 Parkview Court, West Kelowna, BC December 21, 2021


Service entrance cable and location: • <u>Underground - cable material not visible</u>

Service size: • <u>100 Amps (240 Volts)</u>

Main disconnect/service box type and location: • Breakers - basement

System grounding material and type:

<u>Copper - water pipe</u>

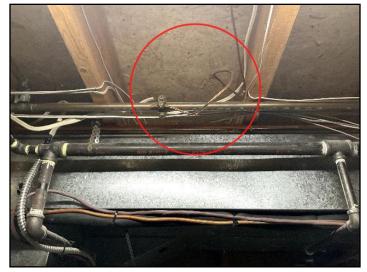

56. Copper - water pipe

Distribution panel type and location: • Breakers - basement

Auxiliary panel (subpanel) type and location: • None

Distribution wire (conductor) material and type: • Copper - non-metallic sheathed

Type and number of outlets (receptacles): • Grounded - typical

Circuit interrupters: Ground Fault (GFCI) & Arc Fault (AFCI): • GFCI - bathroom and exterior


Smoke alarms (detectors): • Present

Carbon monoxide (CO) alarms (detectors): • None noted

Recommendations

SERVICE DROP AND SERVICE ENTRANCE \ Service size

25. Condition: • Marginal service size
The electrical service and panel box installed have reached the maximum capacity. There is no room for future electrical additions (ie: electric car). Budget for service upgrade & panel replacement.
Implication(s): Interruption of electrical service
Location: Basement
Task: Recommend further evaluation by a professional electrician to provide quote for service and panel upgrade.
Time: Discretionary upon possession

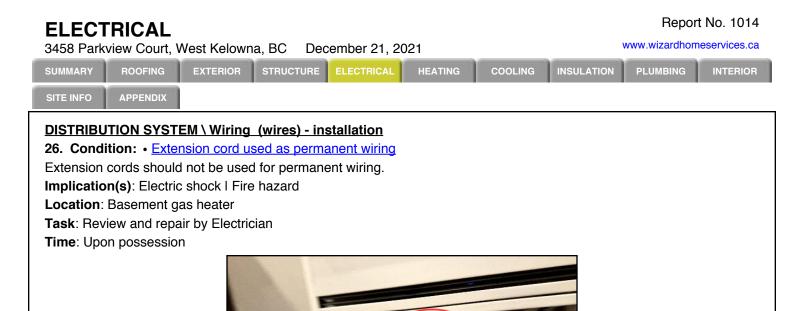

57. Permanent wiring used as extension cord

DISTRIBUTION SYSTEM \ Outdoor wiring (wires)

27. Condition: • Exposed Wires
Exposed electrical wiring observed.
Implication(s): Mechanical damage | Electric shock | Fire hazard
Location: Exterior
Task: Have repaired by electrician
Time: Upon possession

www.wizardhomeservices.ca

ELECTRICAL

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								



58. Exposed Wires

DISTRIBUTION SYSTEM \ Outlets (receptacles)

28. Condition: • GFCI Recommended
It is recommended that outlets near all sinks or water sources be GFCI protected.
Implication(s): Electric shock
Location: Laundry Area
Task: Install GFCI's
Time: Upon possession

ELECTRICAL

3458 Park	58 Parkview Court, West Kelowna, BC December 21, 2021										
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR		
SITE INFO	APPENDIX										
	Γ	Ground fau	ult circuit in	terrunter							
			ground fault inte								
		the GFCI circu	itry within the		ble els						
		outlet checks t	he load		black- (hot)						
		(connected do plugged into re	wnstream and/o		wire						
		constantly for a	a difference			hite _					
		between the cu (live) and neut	urrent in the hot		(ne	vire					
		if there is a diff least 5 milliam									
		current leak an					TEST				
		shuts off the ou				\sim	RESET				
		outlets downst	ream			ground					
		_	_	n 🗖		wire					
		not	_			· // •					
		if the GFC	I is in the tire circuit will))	GFCI				
		be shut down									
		risk of elec	ctric shock	120VAC (los	d)))						


4 120VAC (line)



59. GFCI Recommended

DISTRIBUTION SYSTEM \ Switches

29. Condition: • Location poor (too close to water source) Light switch, exposed wires and junction box below sink are to close to water source at laundry sink.

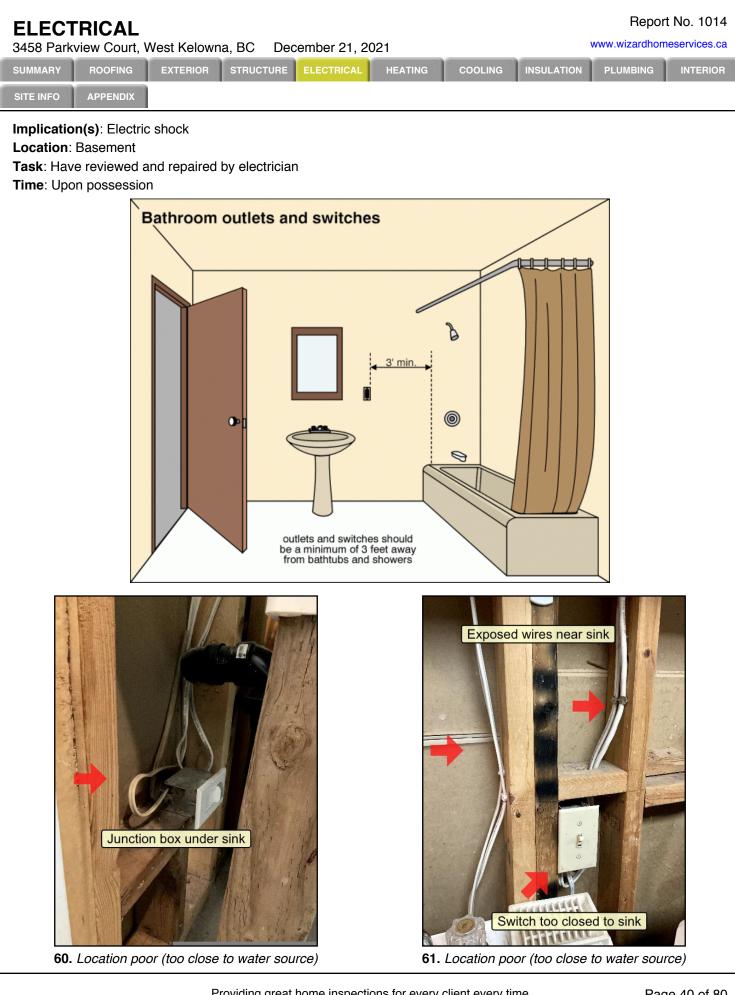

ELECTRICAL			Report	t No. 1014
3458 Parkview Court, West Kelowna, BC	December 21, 2021		www.wizardhom	eservices.ca
SUMMARY ROOFING EXTERIOR STRUC	CTURE ELECTRICAL HEATING	COOLING INSULATION	ON PLUMBING	INTERIOR
SITE INFO APPENDIX				
DISTRIBUTION SYSTEM \ Lights				
30. Condition: • Loose				
Implication(s): Electric shock Fire hazar	ď			
Location: Rear Exterior Wall				
Task: Repair				
Time: Upon possession				

31. Condition: • Loose
Implication(s): Electric shock | Fire hazard
Location: Basement
Task: Repair
Time: Upon possession

62. *Loose*

www.wizardhomeservices.ca

ELECTRICAL

3458 Parkview Court, West Kelowna, BC December 21, 2021

		STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO APPE	PENDIX							



63. Loose

DISTRIBUTION SYSTEM \ Carbon monoxide (CO) alarms (detectors)

32. Condition: • None observed
Recommend installing CO detectors upon possession in appropriate areas. Periodic testing is suggested to ensure proper working order.
Implication(s): Health hazard
Location: Each floor level
Task: Provide

Time: Upon possession

HEATING

 3458 Parkview Court, West Kelowna, BC
 December 21, 2021
 www.wizardhomeservices.ca

 SUMMARY
 ROOFING
 EXTERIOR
 STRUCTURE
 ELECTRICAL
 HEATING
 COOLING
 INSULATION
 PLUMBING
 INTERIOR

 SITE INFO
 APPENDIX
 ELECTRICAL
 HEATING
 COOLING
 INSULATION
 PLUMBING
 INTERIOR

Description

General:

Furnace



64. Furnace



65. Gas fireplace

Providing great home inspections for every client every time

Page 43 of 80

Fireplace

HEATING

3458 Parkview Court, West Kelowna, BC December 21, 2021

3458 Park	view Court, v	vest kelowna,	BC Dece	ember 21, 2	021			Zaranom	0001110000.00
SUMMARY	ROOFING	EXTERIOR S	TRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								
• Furnace	shutoff switcl	h							
Heating s	ystem type:	• Furnace							
Fuel/energ	gy source:	• Gas • Electric	city						
Approxim	ate capacity	: • <u>80,000 BT</u>	<u>U/hr</u>						
Efficiency	• <u>Conventi</u>	onal							
Exhaust v	enting meth	od: • <u>Natural</u>	<u>draft</u>						
Combusti	on air sourc	e: • Outside							
Approxim	ate age: • <u>3</u>	<u>5 years</u>							
Typical lif	e expectanc	:y: • Furnace (convention	al or mid-eff	iciency) 18 t	o 25 years			
Main fuel	shut off at:	Meter							
Auxiliary	heat:								
 Gas firep 									
 Gas space 									
Bacomont	living room								

Basement living room.



66. Gas space heater

• <u>Electric heater</u> basement bathroom



67. Gas space heater

www.wizardhomeservices.ca

HEATING

3458 Parkview Court,	West Kelowna, BC			www.wizardhom	eservices.ca		
SUMMARY ROOFING	EXTERIOR STRUC	TURE ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO APPENDIX							
	68.	Electric heater					

• Radiant floor heating (electric) Upstairs bathroom



69. Radiant floor heating (electric)



70. Radiant floor heating (electric)

HEATING

3458 Parkview Court, West Kelowna, BC December 21, 2021

www.wizardhomeservices.ca

ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	
---------	----------	-----------	------------	---------	---------	------------	----------	--

SITE INFO APPENDIX

Fireplace/stove: • Gas fireplace

Chimney/vent: • Metal

Chimney liner: • Metal

Mechanical ventilation system for building: • Kitchen exhaust fan • Bathroom exhaust fan

Location of the thermostat for the heating system: • Hallway

Limitations

Safety devices: • Not tested as part of a building inspection

Heat loss calculations: • Not done as part of a building inspection

Recommendations

GAS FURNACE \ Life expectancy

33. Condition: • Past life expectancy

Old furnace, have heating specialist estimate remaining life and replacement costs, anticipate replacement. 35 year-old furnace, typically these furnaces last 18 to 25 years. If furnace fails, there will be no heat. Potential health issue if furnace not serviced.

Implication(s): Equipment failure I No heat for building I Possible hazardous combustion products entering home **Location**: Basement Furnace Room

Task: Further Evaluation

Time: Before subject removal



71. Furnace past life expectancy

www.wizardhomeservices.ca

HEATING

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								

FIREPLACE \ Gas fireplace or gas logs

34. Condition: • Gas Service

Ask seller for service records of gas fireplace. If none available, recommend gas fireplace be serviced.

Implication(s): Health and safety precaution

Location: Living room

Task: Have serviced by professional

Time: Prior to use and as regular maintenance



72. Gas Service

COOLING & HEAT PUMP





73. Air Conditioner

Air conditioning type: • <u>Air cooled</u> • Electric Compressor approximate age: • 1 year Typical life expectancy: • 12 to15 years

Limitations

Inspection limited/prevented by: • Cooling systems are not operated when the outdoor temperature is below 15° C • Could not test and operate AC unit due to cold weather. It is a mechanical risk to turn compressor on when temperature is below 15° C.



74. Air Conditioner

INSULATION AND VENTILATION

Report No. 1014

www.wizardhomeservices.ca

3458 Parkview Court, West Kelowna, BC December 21, 2021

ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING

INSULATION PLUMBING

INTERIOR

Description

General:

SITE INFO

· General view of attic

APPENDIX





76. General view of attic

75. General view of attic

Attic/roof insulation material: • <u>Glass fiber</u> Attic/roof insulation amount/value: • 10 inches Attic/roof air/vapor barrier: • <u>Plastic</u> Attic/roof ventilation: • <u>Roof and soffit vents</u> Wall insulation amount/value: • Not determined Foundation wall insulation material: • Not determined Mechanical ventilation system for building: • Kitchen exhaust fan • Bathroom exhaust fan

Limitations

Inspection limited/prevented by lack of access to: • Roof space

Attic inspection performed: • From access hatch

Roof space inspection performed: • From access hatch

Roof ventilation system performance: • Not evaluated

Air/vapor barrier system: • Continuity not verified

Environmental issues are outside the scope of a home inspection: • This includes issues such as asbestos.

PLUMBING

3458 Parkview Court, West Kelowna, BC December 21, 2021


www.wizardhomeservices.ca


INSULATION PLUMBING ROOFING SITE INFO APPENDIX

Description

General:

• Ask the seller for the location of the lid so you know where to direct the service man. Ask the seller when it was last pumped. Over pumping the system is not good for it and therefore, the system should only be pumped if it has not been done so recently.

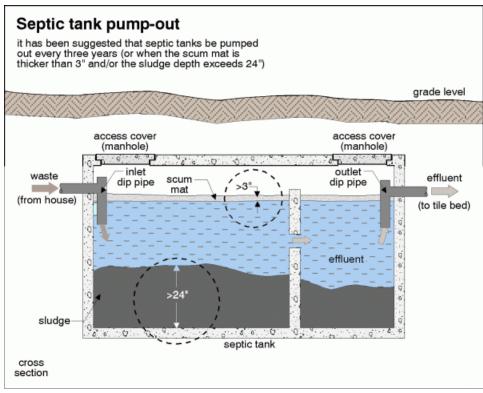

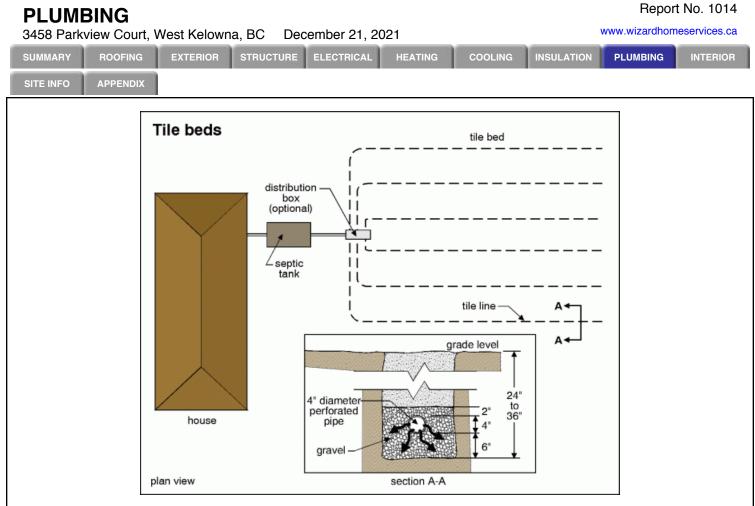

• Hot Water Tank



77. Hot Water Tank

• Gas Meter

PLUMBING

Main Water Shut Off

SITE INFO

3458 Parkview Court, West Kelowna. BC December 21, 2021

iew Court, West Kelowna, BC December 21, 2021 www.wizardhomeservices.ca										
ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	COOLING	INSULATION	PLUMBING	INTERIOR			
APPENDIX										



78. Gas Meter



79. Main Water Shut Off

Water supply source (based on observed evidence): • Public

PLUMBING

3458 Parkview Court, West Kelowna, BC December 21, 2021

5450 Taikwew Court, West Nelowila, BC Becember 21, 2021												
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR			
SITE INFO	APPENDIX											
Service piping into building: • Copper												
Supply piping in building: • Copper • PEX (cross-linked Polyethylene)												
Main water shut off valve at the: • Basement												
Water flow	v and press	ure: • <u>Funct</u>	<u>ional</u>									
Water hea	ter type: •	Conventiona	l									
Water heater fuel/energy source: • Gas												
Water hea	ter manufa	cturer: • Rh	eem									
Water hea	ter tank cap	oacity: • <u>40</u>	<u>gallons</u>									
Water hea	ter approxi	mate age: •	3 years									
Water hea	ter typical I	ife expectar	ncy: • 8 to 12	2 years								
Waste and	l vent pipin	g in building	g: • <u>Plastic</u>									
Floor drai	n location:	None foun	d									
Gas meter	Gas meter location: • Exterior right side											
Main gas shut off valve location: • Gas meter												

Limitations

Fixtures not tested/not in service: • Hot tub • Outdoor faucet (hose bibs/bibbs) shut off for winter

Items excluded from a building inspection: • Water quality • Septic system • Isolating/relief valves & main shutoff valve • Concealed plumbing • Tub/sink overflows • Water heater relief valves are not tested • The performance of floor drains or clothes washing machine drains • Landscape irrigation system

Recommendations


OPTIONAL \ Plumbing 35. Condition: • Upgrade Washer Hookup Rubber supply lines have a history of leaking. Implication(s): Water leaks damage structures and materials Location: Laundry Area Task: Replace with steel braided hoses Time: Discretionary - Monitor www.wizardhomeservices.ca

www.wizardhomeservices.ca

PLUMBING

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								

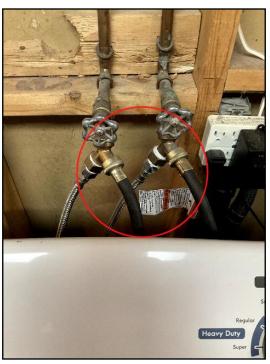

80. Upgrade Washer Hookup

SUPPLY PLUMBING \ Water service pipe

36. Condition: • Leak

Slow water leak noted at main water shutoff valve.

Implication(s): Chance of water damage to structure, finishes and contents | Damage to equipment

Location: Basement Utility Room

Task: Review and repair by Plumber

Time: Before subject removal

www.wizardhomeservices.ca

PLUMBING

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR		
SITE INFO	APPENDIX										




81. Leak

37. Condition: • Corroded copper pipe
Implication(s): Chance of water damage to structure, finishes and contents
Location: Basement Utility Room
Task: Review and repair by Plumber
Time: Upon possession

PLUMBING Steport No. 1014 3458 Parkview Court, West Kelowna, BC December 21, 2021 SUMMARY ROOFING EXTERIOR STE INFO APPENDIX



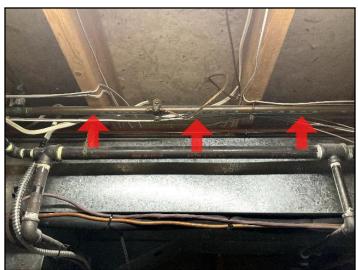

83. Corroded copper pipe

82. Corroded copper pipe

FIXTURES AND FAUCETS \ Faucet

38. Condition: • Loose
Fixtures are loose and can potentially fail and leak if not addressed.
Implication(s): Equipment failure / potential water leak
Location: Basement Bathroom
Task: Improve - Repair
Time: Upon possession

www.wizardhomeservices.ca

PLUMBING

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								



84. Loose taps and faucet

FIXTURES AND FAUCETS \ Shower stall

39. Condition: • Caulking loose, missing or deteriorated
Caulking detail required in both upper and basement bathrooms.
Implication(s): Chance of water damage to structure, finishes and contents
Location: Master Bathroom & Basement Bathroom
Task: Reseal all seams and joins exposed to water
Time: Upon possession

www.wizardhomeservices.ca

PLUMBING

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								



85. Caulking loose, missing or deteriorated



86. Caulking loose, missing or deteriorated



87. Caulking loose, missing or deteriorated

FIXTURES AND FAUCETS \ Toilet

40. Condition: • There is a hole drilled in wall near toilet water line. Ask seller history and why this hole was drilled. **Implication(s)**: Possible pipe freeze history.

Location: Basement Bathroom

Task: Request disclosure

Time: Before subject removal


PLUMBING

3458 Park	view Court, V	Vest Kelowr		www.wizardhomeservices.c					
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								

88. Hole drilled near pipe on wall

INTERIOR

Report No. 1014

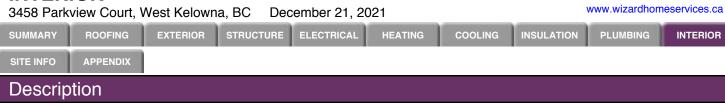


General:


Interior Pictures



89. Dining Room

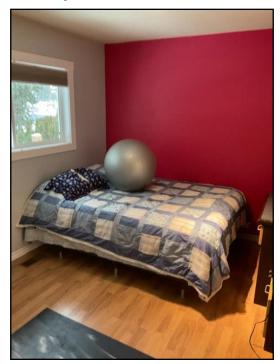

91. Bedroom 1

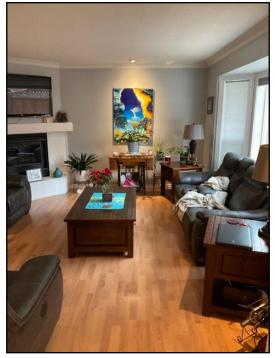

90. Living Room



92. Bedroom 2

INTERIORReport No. 10143458 Parkview Court, West Kelowna, BCDecember 21, 2021www.wizardhomeservices.ca

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								



93. Main Bathroom



95. Basement Bathroom



94. Master Bedroom



96. Lower living room

INTERIOR 3458 Parkview Court, West Kelowna, BC December 21, 2021

www.wizardhomeservices.ca

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOF
SITE INFO		1							





98. Utility room

97. Basement room

Major floor finishes: • Laminate • Tile Major wall and ceiling finishes: • Plaster/drywall

Windows: • Fixed • Sliders

Glazing: • Double

Exterior doors - type/material: • Metal-clad

Appliances: • Refrigerator • Dishwasher • Microwave/Exhaust Fan Combo • Range

Laundry facilities: • Washer • Dryer

Kitchen ventilation: • Discharges to exterior

Bathroom ventilation: • Exhaust fan

Laundry room ventilation: • Clothes dryer vented to exterior

Counters and cabinets: • Inspected

Stairs and railings: • Inspected

Providing great home inspections for every client every time

Page 62 of 80

www.wizardhomeservices.ca

INTERIOR

3458 Parkview Court, West Kelowna, BC December 21, 2021

ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION

INTERIOR

Limitations

SITE INFO

Inspection limited/prevented by:

APPENDIX

Storage in closets and cabinets / cupboards



99. Storage

Restricted access to:

Garage

INTER	IOR							Repor	t No. 1014
3458 Park	view Court,	West Kelown	a, BC Dec	ember 21, 20)21			www.wizardhon	neservices.ca
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX	1							



100. Garage



101. Garage



102. Garage

Not included as part of a building inspection: • Appliances • Aesthetics or quality of finishes • Vermin, including wood destroying organisms. • Underground components (e.g., oil tanks, septic fields, underground drainage systems) • Paint, wallpaper, and other finishes

www.wizardhomeservices.ca

INTERIOR

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								

Percent of foundation not visible: • 75 %

Basement leakage: • Cannot predict how often or how badly basement will leak • Storage in basement limited inspection

Recommendations

RECOMMENDATIONS \ General

41. Condition: • Asbestos / Hazardous Materials

Homes built up until the early 1990's may contain materials that are now considered hazardous such as asbestos and lead paint. Given the age of this house these materials may potentially exist throughout. We are required as home inspectors to inform you of this information and recommend that you review WorkSafe BC's rules and regulations prior to renovating the property. Remediation can be costly.

Suspected asbestos containing materials were observed during inspection. Implication(s): Health issues - Remediation is expensive. Location: Throughout house Task: Further evaluation Time: Discretionary

WALLS \ Plaster or drywall

42. Condition: • Various holes were found in walls of basement that should be patched and sealed. There appears to be cloth stuffed into 2 of the holes possibly to prevent cold air from coming into room.
Implication(s): Possible drafts and vermin entering room
Location: Throughout Basement
Task: Repair holes
Time: Upon possession

Report No. 1014 **INTERIOR** www.wizardhomeservices.ca 3458 Parkview Court, West Kelowna, BC December 21, 2021 COOLING STRUCTURE INSULATION ROOFING INTERIOR SITE INFO APPENDIX 103. Hole in wall 104. Hole in wall

105. Hole in wall


FLOORS \ Ceramic tile, stone, marble, etc 43. Condition: • Grout loose

Implication(s): Tiles may become damaged and become a trip or fall hazard

INTERIOR


3458 Parkview Court, West Kelowna, BC December 21, 2021



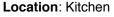

Task: Repair

Time: Upon possession

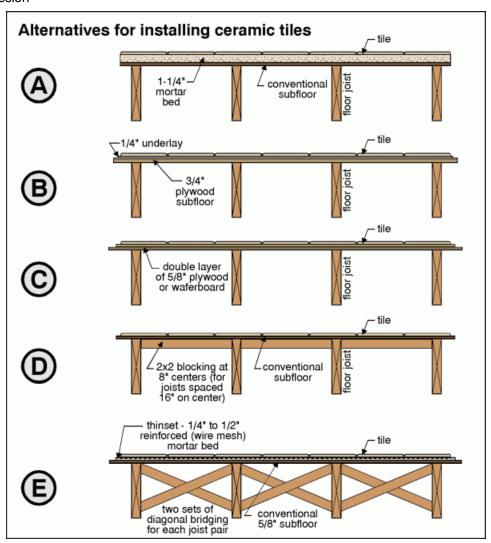


107. Grout loose

106. Grout loose

DOORS \ Doors and frames

44. Condition: • Loose hinges
The door leading to basement has a loose hinge.
Implication(s): Chance of door falling off
Location: Second Floor Basement
Task: Repair
Time: Upon possession

INTER	IOR							Repor	t No. 1014
	view Court, V	Vest Kelown		www.wizardhomeservices.ca					
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								
		F						-	

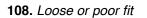


STAIRS \ Landings

45. Condition: • Missing
No landing outside of basement entrance door.
Implication(s): Trip or fall hazard
Location: Second Floor Hallway
Task: Use caution
Time: Ongoing



109. Loose or poor fit

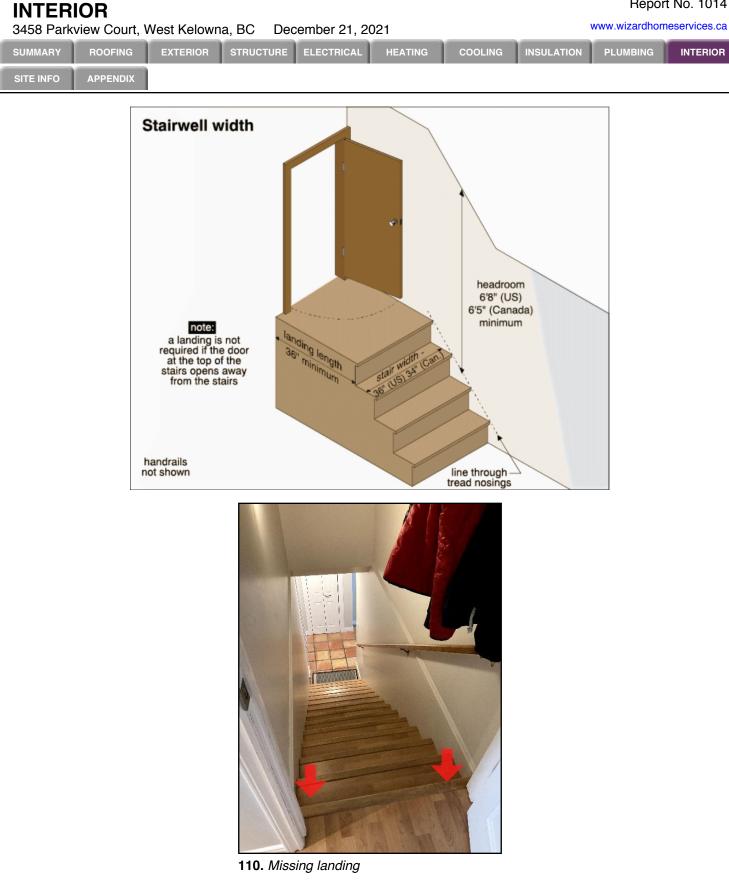

BASEMENT \ Wet basement - evidence 46. Condition: • Efflorescence

Providing great home inspections for every client every time

Page 70 of 80

www.wizardhomeservices.ca

INTERIOR

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								


The left front corner of basement is moist and has efflorescence showing that water is active on outside of concrete foundation. The outside area should be investigated and all water sources should be directed away from house to prevent undermining and frost heave.

Implication(s): Chance of water damage to structure, finishes and contents

Location: Basement


Task: Further evaluation

Time: Upon possession

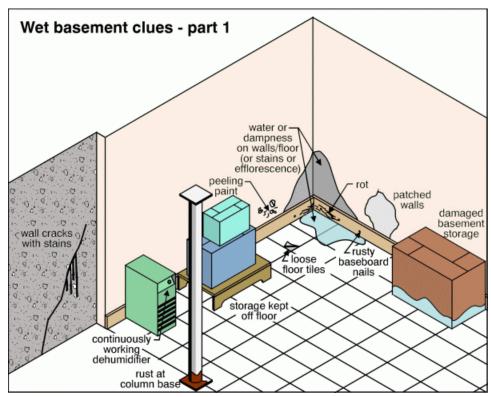



3458 Parkview Court, West Kelowna, BC December 21, 2021

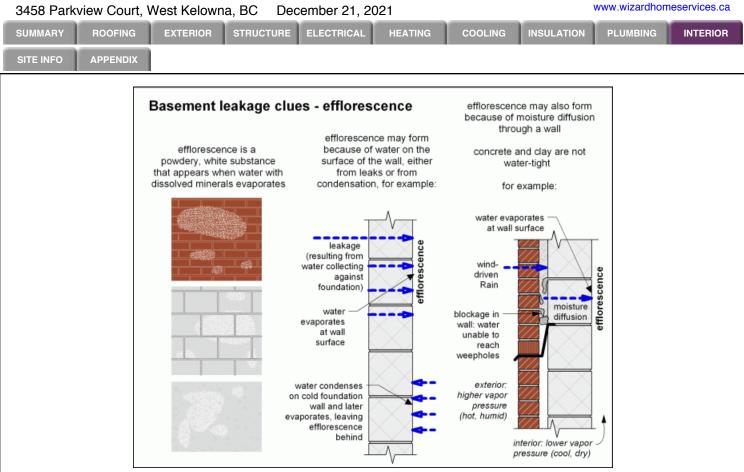



111. Efflorescence

GARAGE \ Floor

47. Condition: • Garage drainage on this house is very important to manage and maintain as the front yard and driveway

www.wizardhomeservices.ca

INTERIOR

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								

slopes towards building.

Implication(s): Water leaks may damage contents, materials and structure and create mould.

Location: Garage

Task: Monitor and maintain drainage at front of house and garage.

Time: Regular maintenance & ongoing





GARAGE \ Door between garage and living space

48. Condition: • <u>No self closer</u>

Garage doors should always have self closing hinges.

Implication(s): Hazardous combustion products entering home

Location: Garage

Task: Improve


Time: Upon possession or before parking vehicle inside.

www.wizardhomeservices.ca

INTERIOR

3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								

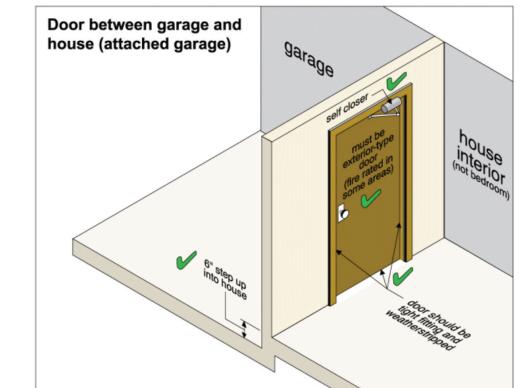



113. No self closer

SITE INFO

3458 Park	view Court, N	Nest Kelown	a, BC Dec	ember 21, 20	021			www.wizardhom	eservices.ca
SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								
Descrip	otion								

General: • Comments are based on visual observations of site elements primarily focused on the potential impact to the main house structure. Comments (if present) made on fencing , lawns, vegetation, landscaping, or other features that do not directly impact the main structure are a courtesy only.

Utilities: • All utilities were on during the inspection.

Approximate age of home: • 30 to 35 years

Approximate date of construction: • 1988

Building type: • Detached home

END OF REPORT

www.wizardhomeservices.ca

APPENDIX 3458 Parkview Court, West Kelowna, BC December 21, 2021

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
SITE INFO	APPENDIX								
	MOH BATTISH	COLUMNER.				вс			
				SCOPE OF INSP					
	The purpose of t property inspecto		pection is to esta	ablish a minimum	, uniform standa	rd for Home Ins	spectors Association	on BC home and	1

This Scope of Inspection of home inspection identifies the range of services and activities that the licensed members of this profession are educated and legally required to provide. The document describes the professional activities and areas of professional practice. The Scope of Inspection defines the minimum standard of practice for all HIA home inspections in British Columbia. The scope of work of an individual home inspector must meet the requirements outlined in this document but may include additional inspection services where the home inspector is qualified and / or has special knowledge. The scope of the home inspector's review of a home is a contractual matter, therefore, any additional services provided to the client beyond the Scope of Inspection, must be communicated through a contractual agreement with the client.

The working premise of this document is that licensed home inspectors will demonstrate minimum, entry level competencies and will conduct their work competently in a variety of home inspection environments. The practice requirements represent the expectations of a "typical" not an "expert" home inspector. A specialist may be hired to provide additional analysis and opinion of adverse conditions or defects identified, beyond this Scope of Inspection.

A home inspection is a limited, non-invasive, visual examination of the current condition of a residential building. A home inspection is designed to report observed deficiencies within specific systems and components of a home. A home inspection provides a description of the condition of the home based on observation of the visible and apparent condition of the structure and components at the time of the home inspection. A home inspection does not guarantee future condition, efficiency, or life expectancy of systems or components. It is not an inspection to verify compliance with any applicable building codes, municipal bylaws or other regulations. A home inspection will not reveal every problem that exists or could ever exist and is not a technically exhaustive inspection.

HOME INSPECTORS ASSOCIATION BC

CODE OF ETHICS

Honesty, justice, and courtesy form a moral philosophy which, associated with mutual interest among people, constitutes the foundation of ethics. The members should recognize such a standard, not in passive observance, but as a set of dynamic principles guiding their conduct. It is their duty to practice the profession according to this code of ethics.

As the keystone of professional conduct is integrity, the Members will discharge their duties with fidelity to the public, their clients, and with fairness and impartiality to all. They should uphold the honor and dignity of their profession and avoid association with any enterprise of questionable character, or apparent conflict of interest.

- 1. The member will express an opinion only when it is based on practical experience and honest conviction.
- 2. The member will always act in good faith toward each client.
- 3. The member will not disclose any information concerning the results of the inspection without the approval of the clients or their representatives.
- The member will not accept compensation, financial or otherwise, from more than one interested party for the same service without the consent of all interested parties.
- Inspectors shall avoid conflicts of interest or activities that compromise, or appear to compromise, professional independence, objectivity, or inspection integrity.
- 6. Home inspectors shall not, directly or indirectly compensate, provide or receive a thing of value, inducement or reward:
 - a. to realtors, brokers or other parties having a financial vested interest in the closing or settlement of real estate transactions,
 - b. for the referral of any business to the inspector or the inspection company, or for inclusion on a list of recommended inspectors, preferred providers, or similar arrangements.
- 7. Members will not use or disclose personal information about clients, home owners, occupants, or the identity of the inspected property or its contents for purposes other than those for which it was collected:
 - except with the informed consent of the client, home owner, occupant, or any other person involved in the home
 inspection, or with the informed consent of all parties affected by the information, or as required by law.
- 8. The inspection work may not be used as a vehicle by the inspector to deliberately obtain work in another field.
- An inspector shall make every effort to uphold, maintain, and improve the professional integrity, reputation, and practice of the home inspection profession. He or she will report all such relevant information, including violations of this Code by other members, to the Association for possible remedial action.
- 10. No member shall be actively engaged as a broker or agent in the sale or purchase of real estate.
- 11. The Inspectors shall not repair any condition found during an inspection or give cost estimates.
- 12. Members shall always be objective in their reporting and not knowingly overstate or understate the significance of observed conditions.

Use of this HIABC Scope of Inspection does not guarantee that the Inspector is a member of Home Inspectors Association BC. To confirm membership, visit www.hiabc.ca

Home Inspectors Association BC <u>www.hiabc.ca</u> Scope of Inspection 2016

1

www.wizardhomeservices.ca

SUMMARY ROOFING HEATING COOLING INSULATION PLUMBING SITE INFO APPENDIX

HOME INSPECTORS ASSOCIATION

Introduction

The Home Inspectors Association BC is a not-for-profit professional society established in 1991. Membership in the Home Inspectors Association is voluntary and its members include private, fee-paid home inspectors. The Home Inspectors Association objectives include promotion of excellence within the profession and continual improvement of its members' inspection services to the public.

A home inspector shall inspect readily accessible, visually Observable, installed systems and components of a residential building using typical fixed operational controls and report identifiable deficiencies of specific systems and components therein including:

- Exterior Systems
- Roofing, Flashings, Penetrations and Chimneys 2
- 3. Structural Systems
- 4. Plumbing Systems
- 5. Electrical Systems
- Interior components 6
- Heating, Ventilation and Cooling (HVAC) Systems Fireplaces and Solid Fuel Burning Appliances 7.
- 8
- Insulation and Ventilation of Attics, Crawlspaces and 9. Unfinished Basements
- Home Inspection Report

Inspections shall be accompanied by a documented report that:

- 1. Describes readily accessible systems and components of a residential building and their condition.
- 2. Makes recommendations on significant deficiencies identified for each system or component that is included in the inspection
- 3. Provides information regarding potential impact if the issues are not addressed
- 4. And includes anything else that is made part of the inspection in accordance with this Scope of Inspection and a home inspection contract

General Home Inspection Inclusions (applicable to all components)

Home inspectors are required to:

- Inspect readily accessible, visually observable, installed systems & 1. components of residential buildings using typical fixed operational controls
- 2. Describe and report systems or components with significant deficiencies or damage including, but not limited to, inadequate performance, missing components, decay, rot, water issues, or other home inspection concerns.
- Describe and report deficiencies that are evident by means of sight, 3. touch, smell and hearing
- Describe and report items that pose an imminent health or safety 4. concern in the opinion of the home inspector
- Describe and report items for which a representative sample was
- inspected, including a description of the sampling process 6. Describe and report the rationale for exclusion and limitation to the inspection of any system, component, procedure or method included in this Scope of Inspection
- 7. Recommend further evaluation or investigation by a Qualified Professional where:
 - a. conditions are identified that may constitute a hazard to occupants
 - b. conditions and systems and components exceed the collective knowledge and training of the home inspector in the opinion of the home inspector
- Include in the report, documentation of evidence, such as supporting images (such as photographs or sketches) to provide information regarding observed deficiencies, where deemed appropriate by the home inspector Produce the report in writing.
- 10. Include in the report the significant components that appear to be at or near the end of their normally expected service life

SCOPE OF INSPECTION

General Home Inspection Exclusions (applicable to all components)

Home inspectors are NOT required to:

- 1. Predict the probability of failure or remaining service life of any system or component or offer any warranty, guarantee or certifications for any system or component
- 2. Describe the compliance with regulatory requirements (codes, regulations, laws, ordinances, etc.)
- 3. Estimate the cost for operation of a particular system or component and / or the cost of remediation of any identified conditions
- 4. Identify the cause(s) of observed conditions or deficiencies
- Identify the methods, materials and cost(s) for correcting (repairing or replacing) observed conditions
 Identify the condition of systems or components that are
- inaccessible, obstructed, hidden or contain latent defects
- 7. Identify the presence of any potential hazards including, but not limited to, asbestos, mould, PCB, infestations of vermin and wood destroying organisms, carcinogens, radon gas, lead paint, urea formaldehyde, toxic or flammable chemicals, noise, and contaminants in soil, water and air
- 8. Describe the adequacy, effectiveness, or efficiency of any system or component
- 9. Inspect common areas in multi-unit housing
- 10. Inspect systems and components that are not installed 11. Inspect decorative items
- 12. Operate any system or component that is shut down or that does not turn on with the use of typical fixed operational controls
- Inspect underground items whether abandoned or active 13. including, but not limited to, storage tanks and / or indications of their presence
- 14. Offer any advice regarding the purchase of the property
- 15. Enter an area or perform an inspection procedure or method in the opinion of the home inspector, could be dangerous to the home inspector or cause damage to the property or its systems or components, such as, but not limited to walking on roof surfaces,
- climbing ladders, entering attic spaces, etc. 16. Move items, contents, debris, soil, snow, ice or other equipment or dismantle any system or component that obstructs access or visibility for the home inspection
- 17. Review third-party reports including, but not limited to, depreciation reports and engineering reports
- 18. Identify and report any geological, geotechnical or hydrological conditions
- 19. Identify every problem that exists or could ever exist and report a technically exhaustive inspection

This Scope of Inspection is not required to limit inspectors from:

- A. Including other inspection services in addition to those required by this Scope of Inspection provided the inspector is appropriately qualified to do so.
- B. Excluding systems and components from the inspection if requested by the client or as dictated by circumstances at the time of the

The Home Inspectors Association Scope of Inspection applies to inspections of part or all of a building for the following building types:

- single family dwelling, detached, semi-detached, or row house
- 2. multi-unit residential building
- residential building held in divided or undivided co- ownership 3.
- residential building occupied in part for residential occupancy and in part for a commercial occupancy, as long as the latter use does not exceed 40% of the building's total area, excluding the basement. 4

Home Inspectors Association BC www.hiabc.ca Scope of Inspection 2016 2

www.wizardhomeservices.ca

100	-	-					-	23	121	_
SUMMARY	ROOFING	EXTERIOR	STRUC	CTURE	ELECTRICAL	HEATING	COOLING	INSULATIO	DN PLUMBING	INTER
SITE INFO	APPENDIX									
	HOME INSPEC	FORS ASSOCIA								
	1. EXTERIOR S	YSTEMS								
	1.1 The inspector	shall:				3.2 The inspect		ired to: ice or architectural	convico	
	A. inspect:	covering(s), flashin	a and trim						tural system or compon-	ent.
	all exterior do	ors.	-			4. PLUMBING	SVSTEMS			
	 attached or a associated ra 	djacent decks, bal ilings.	conies, stej	ps, porch	es, and the	4. FLOWIDING	STOTENIS			
		ffits, and fascias v	here acces	ssible fror	n the ground	4.1 The inspect A. inspect:	or shall:			
	5. vegetation, gr	rading, surface dra			ty when any of	 interior wat 	ter supply and d	istribution systems	including all fixtures an	d
		ly to adversely affective tios, and drive way			a entrances	faucets. 2. drain. wast	e and vent syste	ems including all fiv	dure	
	7. landscaping	structure attached	d or adjace			water heat	ing equipment a		ting systems, flues &	
		rsely affect the bui ge or carport attac		ached.		chimneys. 4. fuel storage	e and fuel distrit	oution systems.		
	9. garage doors	and garage door		loneu.		5. drainage s		mps, and related pi	ping.	
	B. describe 1. exterior wall of	coverina(s).				B. describe: 1. water supp	ly, distribution.	drain, waste. and v	ent piping materials.	
	C. report:					2. water heat	ing equipment ir	ncluding the energy	/ source.	
	1. the method(s) used to inspect t	ne exterior	wall eleva	ations.	3. location of	main water and	main fuel shut-off	valves.	
	1.2 The inspector	is NOT required	to:			4.2 The inspect	or is NOT requ	ired to:		
	A. inspect: 1. screening, st	nutters, awnings, a	and similar :	seasonal	accessories.	A. inspect: 1. clothes wa	shing machine o	connections.		
	2. fences.	ootoobaical or by	Irological or	onditions		the interior	s of flues or chir	nneys which are no	ot readily accessible	
	4. recreational	eotechnical or hyd facilities.	.Tological co	onulions.			pumps, or water litioning systems	r storage related eo 3.	quipment.	
	5. outbuildings.		nd dooko			solar water	heating system	IS.		
		eak-walls, dykes an rol and earth stabil		asures.			vn sprinkler syst ste disposal sys			
		Me				B. determine:			te see and the second se	
	2. ROOF SYSTE	:1015					ater supply and y or quality of th		tems are public or priva	te.
	2.1 The inspector	shall:				C. operate:				
	A. inspect: 1. readily acces	sible roof covering	as.			1. safety vaiv	es or shut-off va	iives.		
	readily acces	sible roof drainag				5. ELECTRIC	AL SYSTEMS	;		
	 readily acces readily acces 	ssible flashings. ssible skylights, ch	imnevs. an	nd roof per	netrations.	5.1 The inspect	or shall.			
	B. describe		-			A. inspect:				
	C. report	ering and report the	e method(s	i) used to	inspect the root	 service dro service ent 		rs, cables, and rac	eways	
		s) used to inspect	the roof(s).			service equ	uipment and ma		cways.	
	2.2 The inspector	is NOT required	to:			 service gro interior cor 		vice panels and sul	h nanels	
	A. inspect:	-				6. distribution	a second constrained		b pariels.	
		d satellite dishes. ues or chimneys w	/hich are nc	ot readily	accessible.		t protection devi		ixtures, switches, and	
	other installe	d accessories. iter				receptacles	S.			
	the roof syste	511(5).						rrupters (GFCI) (if (AFCI) (if appropri		
	3. STRUCTURA	L SYSTEMS				B. describe:	·			
	3.1 The inspector	shall:						ng of the service. t(s) and subpanel(s).	
	A. inspect:				and from t	wiring method		, , , , , , , , , , , , , , , , , , ,	,	
		nponents including sample of structur				C. report: 1. presence c	of solid conducto	or aluminum branch	n circuit wiring.	
	is suspected	or where clear ind	ications of p	possible of	deterioration	absence of	carbon monoxi	de detectors (if app		
		is NOT required ice or where no de					f smoke detecto of ground fault ci	rs. rcuit interrupters (C	GFCI).	
	B. describe:							t interrupters (AFC		
	 foundation(s) floor structure 					5.2 The inspect	or is NOT reau	ired to:		
	wall structure	(s).				A. inspect	-			
	 ceiling structu roof structure 						trol devices unl ems and compo		ne only control device.	
	C. report:	. ,	etructural -	ompone-	nte	low voltage	wiring, system	s and components.		
		limiting access to I to inspect the und					iring, systems a ower distributior		t a part of the primary	
		I to inspect the atti		-		5. telecommu	nication equipm			
						B. measure:1. amperage,	voltage, or imp	edance.		
						, - · 3-,	5 · · · P			

APPENDIX

3458 Parkview Court, West Kelowna, BC December 21, 2021 www.wizardhomeservices.ca

MMARY ROOFING EXTERIOR STRUCT	
TE INFO APPENDIX	
6. INTERIOR	9. INSULATION and VENTILATION of ATTICS, CRAWLSPACES
6.1 The inspector shall:	AND UNFINISHED BASEMENTS
A.inspect:	9.1 The inspector shall:
 walls, ceilings, and floors. 	A.inspect:
 steps, stairways, and railings. countertops and a representative number of 	1. insulation and vapor retarders in unfinished spaces.
 a representative number of doors and windo 	
walls, doors and ceiling separating the habita	
garage. B.describe:	areas where moisture is generated.
 materials used for walls, ceilings and floors. 	 B.describe: 1.type of insulation and vapour retarders in unfinished spaces.
2. doors.	2.ventilation of attics and foundation areas.
3. windows.	3.mechanical ventilation systems.
C.report: 1. absence or ineffectiveness of guards and ha	andrails or other 4.ventilation systems in areas such as kitchens, bathrooms and laundry areas where moisture is generated.
potentially physical injury hazards.	C.report:
	1. absence of insulation in unfinished spaces at conditioned surfaces.
6.2 The inspector is NOT required to: A.inspect:	 absence of ventilation in areas where moisture is generated such as kitchens, bathrooms and laundry rooms.
1. paint, wallpaper, and other finish treatments	
2. carpeting.	9.2 The inspector is NOT required to:
 window treatments. central vacuum systems. 	A.disturb insulation or vapor retarders. B.determine indoor air quality.
5. household appliances.	C.determine indoor air quality.
recreational facilities.	
7. HEATING, VENTILATION & COOLING ((HVAC) SYSTEMS
7.1 The inspector shall:	
A. inspect:	and in a sector and
 readily accessible components of installed h through wall cooling equipment. 	leating, central and
 vent systems, flues, and chimneys. 	
fuel storage and fuel distribution systems.	
B. describe: 1. energy source(s).	
 heating and/or cooling method(s) by disting 	uishing characteristics.
chimney(s) and/or venting material(s).	
 the combustion air sources. the exhaust venting methods (naturally aspi 	irated induced draft
direct vent, direct vent sealed combustion).	
7.2 The inspector is NOT required to: A. inspect:	
1. interiors of flues or chimneys which are not	readily accessible.
2. heat exchanger.	
 humidifier or dehumidifier auxiliary equipme electronic air filters. 	nt.
5. solar heating systems.	
B. determine:	
1. system adequacy or distribution balance.	
 FIREPLACES AND SOLID FUEL BURN (Unless prohibited by the authority having juris) 	
8.1 The inspector shall:	
A. inspect:	
 system components vent systems and chimneys 	
B. describe:	
 fireplaces and solid fuel burning appliances chimneys 	
8.2 The inspector is NOT required to:	
A. inspect:	
 interior of flues or chimneys screens, doors and dampers 	
3. seals and gaskets	
4. automatic fuel feed devices	d or growity
 beat distribution assists whether fan assisted ignite or extinguish fires 	a or gravity
C. determine draught characteristics	
D . move fireplace inserts, stoves, or firebox conte	ents
	spectors Association BC www.hiabc.ca Scope of Inspection 2016

A part of a system.

Confined Spaces

- An enclosed or partially enclosed area that: 1. Is occupied by people only for the purpose of completing work.

2. Has restricted entry/exit points.

3. Could be hazardous to people entering due to: a. its design, construction, location or atmosphere.

- b the materials or substances in it or
- c. any other conditions which prevent normal inspection procedure.

Decorative

Ornamental; not required for the operation of the essential systems and components of a building.

Describe

To report a system or component by its type or other observed, significant characteristics to distinguish it from other systems or components.

Determine

To find out; or come to a conclusion by investigation.

Dismantle

To take apart or remove any component, device, or piece of equipment that would not be taken apart or removed by a homeowner in the course of normal and routine home owner maintenance.

Engineering Service

Any professional service or creative work requiring engineering education, training, and experience and the application of special knowledge of the mathematical, physical and engineering sciences to such professional service or creative work as consultation, investigation, evaluation, planning, design and supervision of construction for the purpose of assuring compliance with the specifications and design, in conjunction with structures, buildings, machines, equipment, works or processes.

Functionality

The purpose that something is designed or expected to fulfill.

Further Evaluation

Examination and analysis by a qualified professional, tradesman or service technician beyond that provided by the home inspection. Home Inspection

The process by which an inspector visually examines the readily accessible systems and components of a building and which describes those systems and components in accordance with this Scope of Inspection

Household Appliances

Kitchen, laundry, and similar appliances, whether installed or freestanding.

Inspect

To examine readily accessible systems and components of a building in accordance with these Scope of Inspection, where applicable using normal operating controls and opening readily openable access panels. Inspector

A person hired to examine any system or component of a building in accordance with this Scope of Inspection.

Installed Set up or fixed in position for current use or service.

Monitor

Examine at regular intervals to detect evidence of change.

Report

To communicate in writing.

Representative Number

One component per room for multiple similar interior components such as windows and electric outlets; one component on each side of the building for multiple similar exterior components. Roof Drainage Systems

Components used to carry water off a roof and away from a building. Sample

A representative portion selected for inspection.

Service Life/Lives

The period during which something continues to function fully as intended.

Significant Deficiency

A clearly definable hazard or a clearly definable potential for failure or is unsafe or not functioning.

Shut Down

A state in which a system or component cannot be operated by normal operating controls.

Solid Fuel Burning Appliances

A hearth and fire chamber or similar prepared place in which a fire may be built and which is built in conjunction with a chimney; or a listed assembly of a fire chamber, its chimney and related factory-made parts designed for unit assembly without requiring field construction.

Structural Component

A component that supports non-variable forces or weights (dead loads) and variable forces or weights (live loads).

System

A combination of interacting or interdependent components, assembled to carry out one or more functions

Technically Exhaustive

An inspection is technically exhaustive when it is done by a specialist who may make extensive use of measurements, instruments, testing, calculations, and other means to develop scientific or engineering findings, conclusions, and recommendations.

Under-floor Crawl Space

The area within the confines of the foundation and between the ground and the underside of the floor.

Unsafe

A condition in a readily accessible, installed system or component which is judged to be a significant risk of personal injury during normal, day-to-day use. The risk may be due to damage, deterioration, missing or improper installation. Vapour Barrier

Material used in the building envelope to retard the passage of water vapour or moisture

Visually Accessible Able to be viewed by reaching or entering.

Wiring Methods

Identification of electrical conductors or wires by their general type, such as "non-metallic sheathed cable" ("Romex"), "armored cable" ("bx") or "knob and tube", etc.

Use of this HIABC Scope of Inspection does not guarantee that the Inspector is a member of the Home Inspectors Association BC. To confirm membership, visit www.hiabc.ca

Home Inspectors Association BC www.hiabc.ca Scope of Inspection 2016 5

3458 Parkview Court, West Kelowna, BC